

These instructions describe the Bom Working Lights montage kit. Read these instructions thoroughly before beginning the procedure.

Part List

POZ	PART NUMBER	DESCRIPTION	QTY
1	031712	NUT	4
2	414390310	WORK LAMP BRACKET	1
3	X30391104	WORK LAMP	2
4	542390410	ROCKER SWITCH	1
5	414392419	HARNESS	1
6	172952176	CLAMP	2
7	4542815	CLAMP	2
8	106001612	BOLT	4
9	14080006	CABLE STRAP	30

**NOTICE**

Use all applicable safety precautions while working on, around, or under any machinery.


**WARNING**

Failure to follow all safety precautions when working on this equipment could cause death, serious injury, or damage to property and equipment.


**NOTICE**

The bolts used in the assembly group must have a tightening torque of 75 Nm.


Park the machine on a level and stable surface, level the machine, retract the boom completely, put the gearbox in the (N) NEUTRAL position and engage the parking brake. Ensure sufficient clearance and switch off the machine.

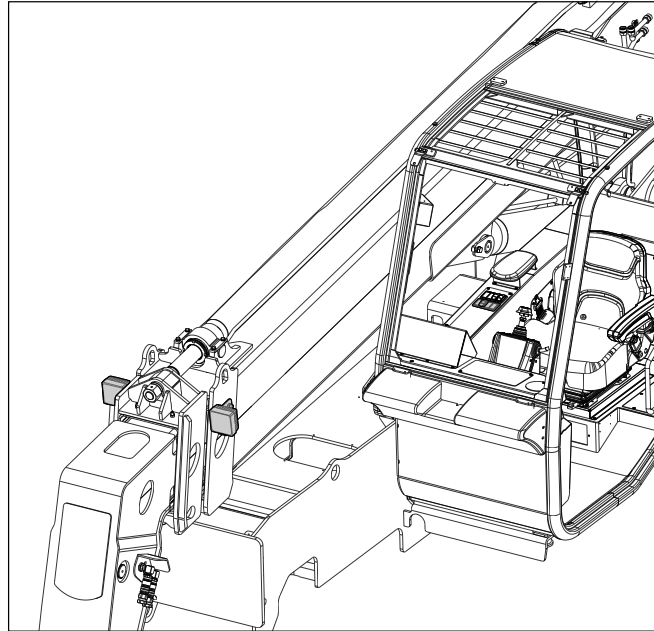

To install the lighting lamp mounted on the boom, insert the M12x65 bolt (5) into the M12 nut (4) in the bracket (1) shown in the diagram and tighten the bolt to a torque of 75 Nm. Attach the work lamp (2) to the installed bracket and tighten the nut (3).

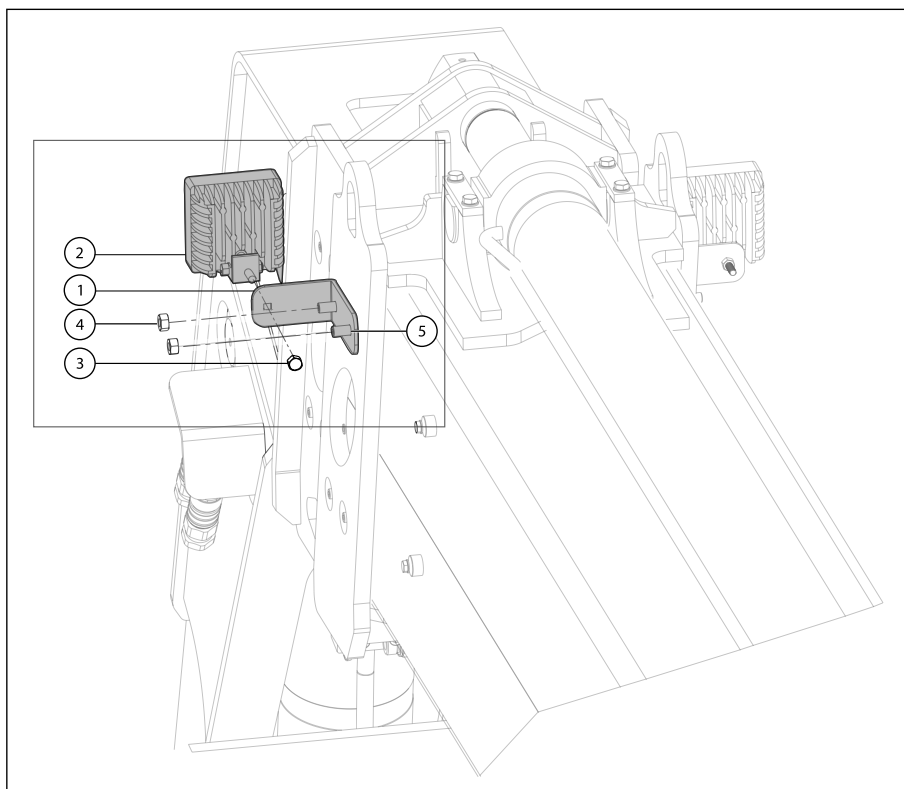

Insert the switch (1) into the console inside the cabin.

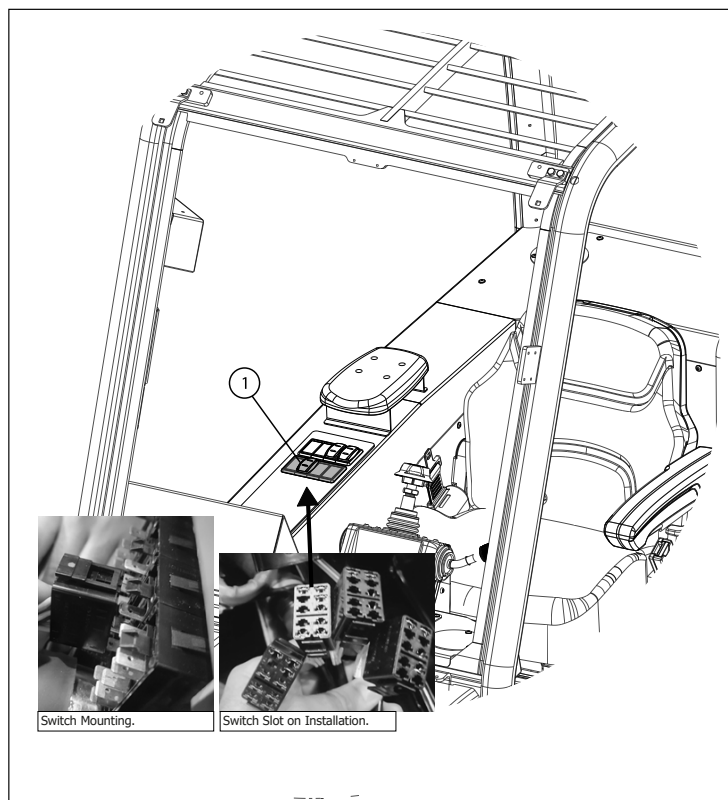

Connect the electrical wiring to the boom-mounted work lights as shown in the diagram.

Secure the electrical cables to the boom hydraulic pipes at 150 mm intervals along the pipe row using cable ties (30 pieces).

