

Part number **ELEC-747** has been superseded. After this replacement, units will no longer be equipped with a charger interlock. The following models/serial ranges need additional electrical connections to use this part.


If installing this on:

Model HB-1030, Serial Number D01-10002 to D01-13015

Model HB-1430, Serial Number D02-10002 to D02-13778

Use part number ELEC-664 to connect terminal blocks 18-19:

If terminal blocks 18-19 are already connected, this retrofit is already installed.

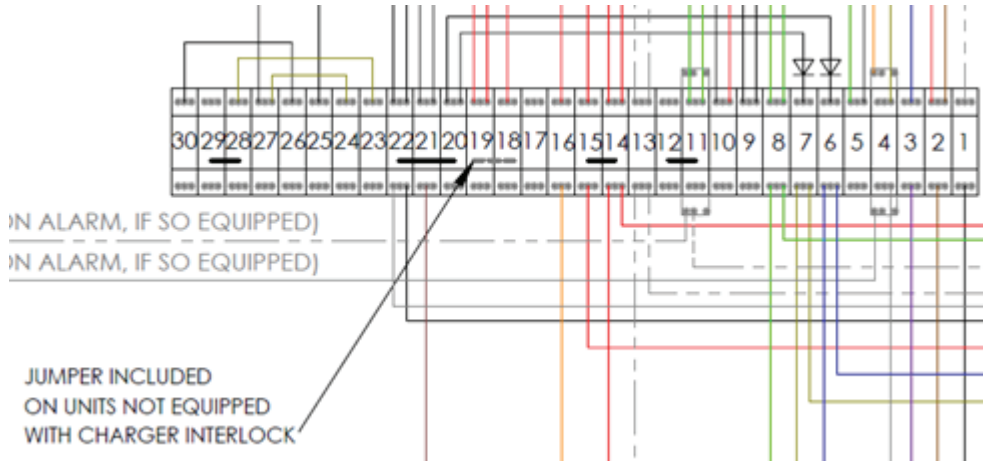

If installing this on:

Model HB-1030CE, Serial Numbers E01-10015 to E01-19999; E110001 to E210011; A210012 to A210018


Model HB-1430CE, Serial Numbers E02-10014 to E01-19999; E210002 to E210011; A210012 to A210018

Instead of removing the charger wires, leave them connected to the 7 amp fuse (B+) and the key switch, cut them and butt splice them together.

If installing this on:

Model HB-1030CE, Serial Numbers E52020 to E52068; CE52032 to CE52044


Cut off one of the female connectors on the yellow wires and replace with a male connector (ELEC-673). Connect the two charger interlock leads to each other.

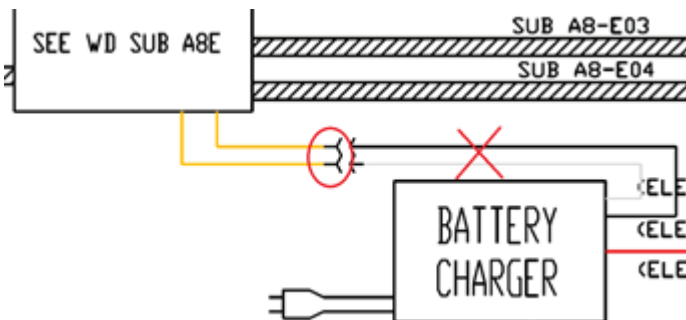

If installing this on:

Model HB-1230, Serial Number D08-10000 to D08-19999

Take the black wire from the charger interlock out of terminal block #2. Cut and strip the old charger white interlock wire and install into terminal block #2.

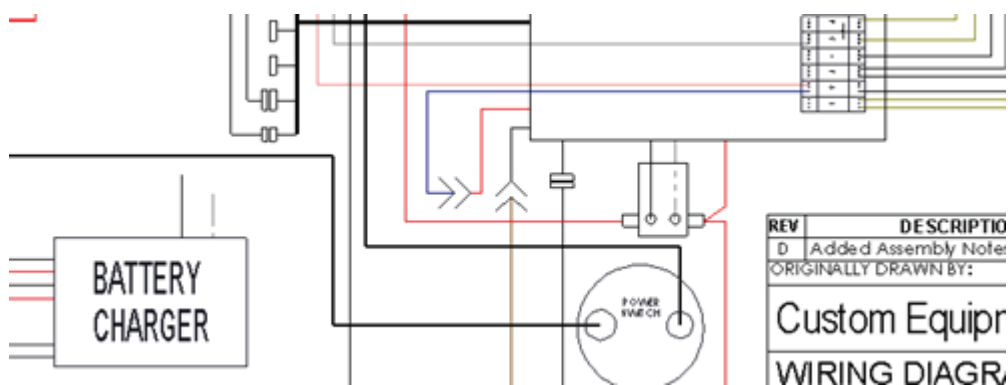


If installing this on:

Model HB-1230, Serial Number D08-20040 to D08-30753

Model HB-1230CE, Serial Number E08-25001 to E08-35001

Cut off the male connector on the red wire and replace with a female connector (ELEC-674). Connect the two charger interlock leads to each other.

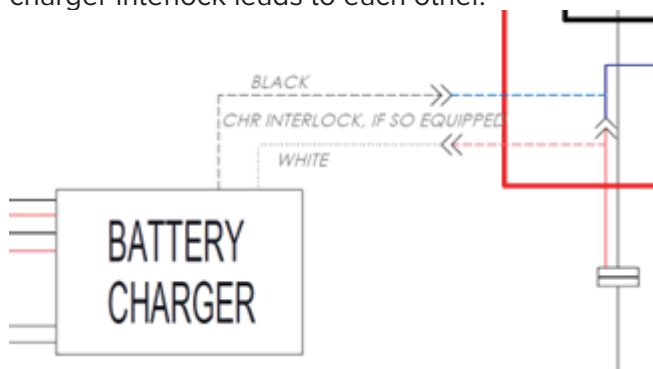

Revision:

A: Initial Release